



**KURT** WORKHOLDING

# **PFW440C**

# **PFW440D**

# **PFW440S**

**Operating Instruction Manual**



**ENGLISH**

# TABLE OF CONTENTS

Introduction .....	3
Installation & Mounting Guide .....	4
Jaw Installation .....	5
Jaw Positioning .....	6
Side & End View .....	7
PFW440 Parts List .....	8
PFW440 Mechanical Drawing .....	9
Standard Jaw Options.....	10
Centerline Adjustment & Lash Removal.....	11
Machining the Carvable Jaws .....	12
Maintenance Schedule.....	13
Warranty.....	15

## VISE DATA

Use this to fill out information about your vise for quick reference.

Purchase Date: \_\_\_\_\_ - \_\_\_\_\_ - \_\_\_\_\_

Purchase Order: \_\_\_\_\_

Purchased From: \_\_\_\_\_

Delivery Date: \_\_\_\_\_

Serial No.: \_\_\_\_\_

**NOTE: MAKE SURE TO REGISTER YOUR WARRANTY ONLINE AT  
KURTWORKHOLDING.COM**

# INTRODUCTION

Thank you for purchasing a Kurt Precision Force vise. The PFW Series of vises are top of the line workholding options for today's rapidly growing 5-Axis market. Backed by a lifetime warranty against workmanship and material defects, these vises will perform at the highest levels of precision and reliability for years to come, when used and maintained properly.

Kurt Anglock maintains it's time tested design, which gives you the part pull down that you need when machining high end parts. Other features include:

- Gibbed jaws for maximum clamping repeatability
- Multiple interchangeable jaw options
  - Carvable (PFW440C)
  - Dovetail (PFW440D)
  - Serrated (PFW440S)
- Easily adjustable center line
- Fast and effortless lash removal system
- Double ended screw for flexible vise operation

PFW VISE CLAMP FORCE	
TORQUE FT-LBS	FORCE IN LBS.
10	720
20	1,520
30	2,250
40	3,050
45	3,375

## OPERATING INSTRUCTIONS


For proper vise operation insert the handle onto the hex of the vise. This handle, combined with the correct amount of torque will provide you with all the clamping force you will need to machine your parts. **DO NOT** use any other type of pressure to open or close your vise.

The uses of handle extensions, air impact wrenches, breaker bars, or hammer strikes are not recommended and will void the warranty if used. This will also cause damage to the central holding block and screw threads. If you need more clamping force you may require a larger vise.

To properly clamp a part in your Kurt vise you should place the part in the center of the jaws. Clamping only on one side can result in loss of accuracy. If one-sided clamping is necessary you **MUST** use a dummy part on the other side.

# INSTALLATION & MOUNTING


All of the vises in the PFW Series can be mounted with 1/2 inch SHCS using the counter-bored through holes in the center of the rails of the vise. Additional hole locations are shown below.

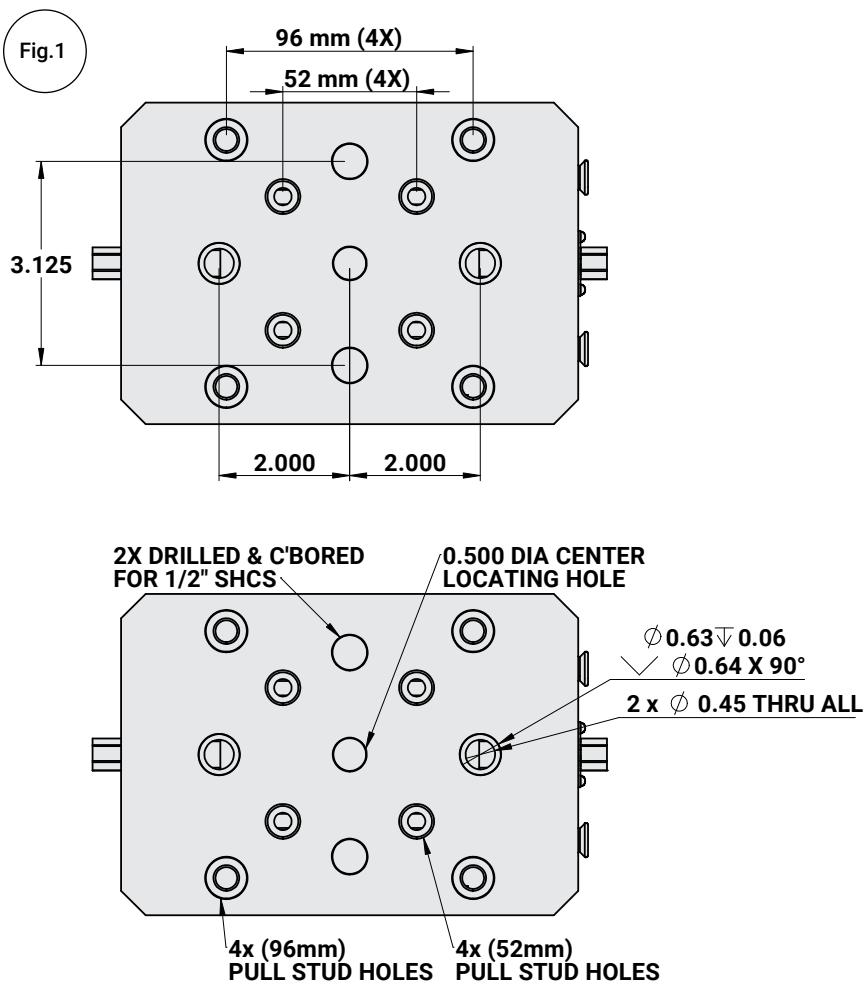

# JAW INSTALLATION

The jaws of this vise can be easily installed and removed by hand.

1. Grasp the jaw with two hands with your fingers towards the center of the vise and your thumbs to the back.
2. Place the forward bottom edge of the jaw against the vise as shown and slide jaw back to hook jaw on nut.
3. Snap the back of the jaw down and over the spring-loaded plungers to finish installation.
4. Reverse installation steps to remove jaws.

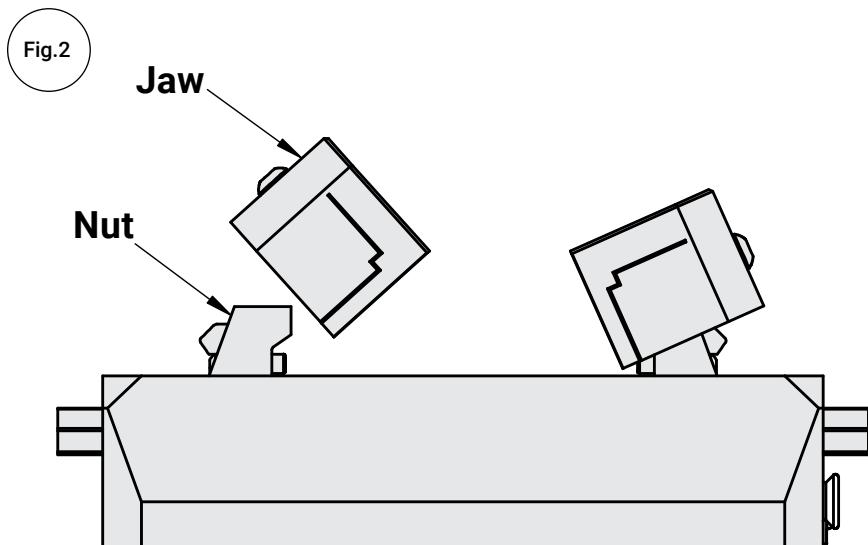


# JAW POSITIONING


**Note:** Dimensions below are in inches unless specified.

<b>A</b>	1.672
<b>C</b>	7.000
<b>D</b>	3.500
<b>AA</b>	4.125
<b>BB</b>	4.375
<b>CC</b>	4.625
<b>DD</b>	4.501
<b>EE</b>	0.625
<b>FF</b>	1.125
<b>NN</b>	4.000
<b>OO</b>	0.190
<b>PP</b>	0.303
<b>QQ</b>	0.770
<b>RR</b>	0.885
<b>TT</b>	2.922

## Serrated Jaws (PFW440S)

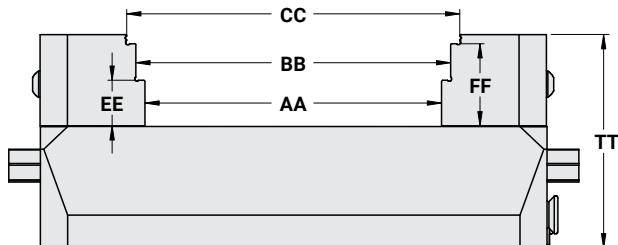

## Carvable Jaws (PFW440C)

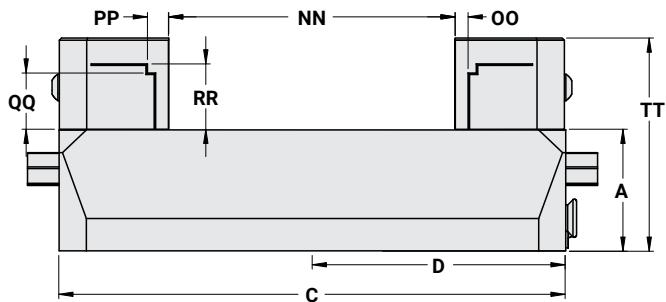

## Dovetail Jaws (PFW440D)



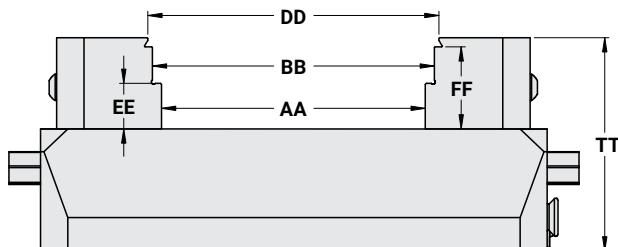


Fig.4

# SIDE & END VIEW

**Note:** Dimensions below are in inches unless specified.

<b>A</b>	1.672
<b>B</b>	4.000
<b>C</b>	7.000
<b>D</b>	3.500
<b>G</b>	7/16
<b>H</b>	2.000
<b>I</b>	1.313
<b>S</b>	4.921

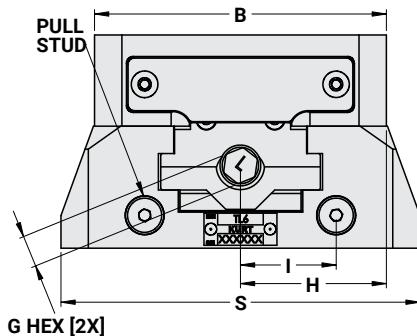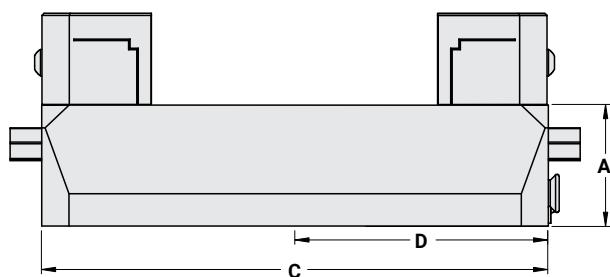

# PFW440 PARTS LIST

ITEM#	PART#	DESCRIPTION	QTY.
<b>1</b>	PFW440-1	BODY	1
<b>2</b>	PF420-2*	MOVABLE JAW	2
<b>3</b>	PFW420-3L	NUT 9/16-18 LEFT HAND THREAD	1
<b>4</b>	PFW420-3R	NUT 9/16-18 RIGHT HAND THREAD	1
<b>5</b>	PFW440-5	SCREW	1
<b>6</b>	PFW420-53	REAR COVER	2
<b>7</b>	PFW440-102	MODEL/SERIAL NUMBER TAG	1
<b>9</b>	PFW420-212	CENTRAL HOLDING BLOCK	1
<b>10</b>	3600V-191-SA	Subassembly includes: Protective Plug (3600V-191) and O-Ring (605-03)	2
<b>11</b>	03-0021	SBHCS 10-32 X 0.375 LG	4
<b>12</b>	03-0109	SBHCS 6-32 X 0.187 LG	4
<b>13</b>	04-0028	DOWEL PIN 0.1875 X 0.5 LG	2
<b>14</b>	07-0230	U-TYPE DRIVE SCREW #2 X 1/4 L	2
<b>15**</b>	PF420-367	PULL STUD FOR LIFTING VISE	2
<b>16</b>	PFW420-366	SPRING PLUNGER	2
<b>17</b>	PFW420-272	THRUST WASHER COLLAR	1
<b>18</b>	PF420-169	COMPRESSION SPRING 0.25Ø OD X 0.47 LG X 0.065 Ø WIRE	4
<b>19</b>	PFW420-334	PLUNGER	4
<b>20</b>	PFW420-311	SPRING 0.219 O.D. X 0.75 F.L. X 0.03 C.S.	4
<b>21</b>	PFW420-197	0.361 ID X 0.472 OD SMALLEY WAVE SPRING SSB-0047	2
<b>22</b>	PFW420-29	0.438 OD X 0.156 ID x 0.02 - 0.04 THICK WASHER	2
<b>23</b>	PFW420-230	0.148 ID X 0.312 OD X 0.062 WIDE HARDENED WASHER	2
<b>24</b>	00-1156	SHCS 6-32 X 0.156 LG	2
<b>25</b>	00-0189	SHCS 6-40 X 0.25 LG	2
<b>26</b>	03-0617	8-32 X 0.375 LG IP15 TORX DRIVE BUTTON HEAD SCREW	4
<b>27</b>	PF420-16	PAD GUIDE	4

\*Note: PF440C Carvable Jaw - PF420-2C


PF440D Dovetail Jaw - PF420-2D

PF440S Serrated Jaw - PF420-2S

\*\*Pull Stud not included – available as an accessory at [www.kurtworkholding.com](http://www.kurtworkholding.com).

# PFW440 MECHANICAL DRAWING


Fig.5

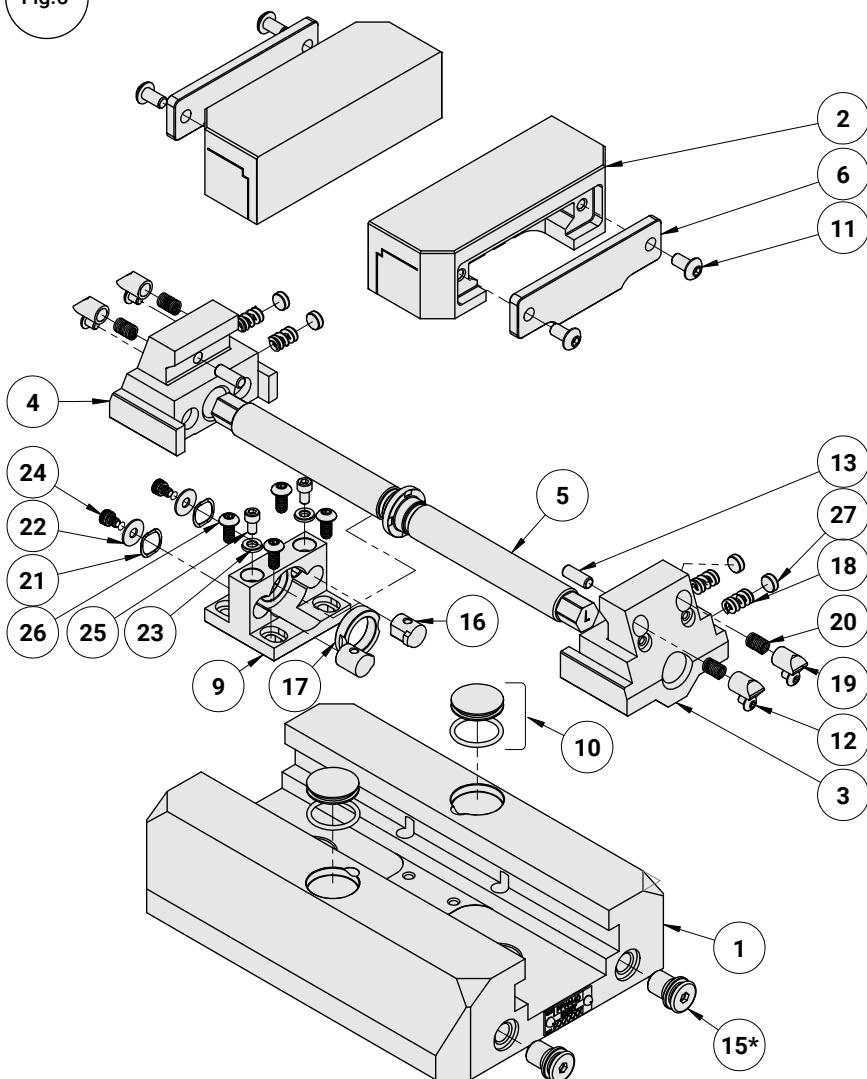


\*Pull Stud not included – available as an accessory at [www.kurtworkholding.com](http://www.kurtworkholding.com).

## STANDARD JAW OPTIONS


Fig.6

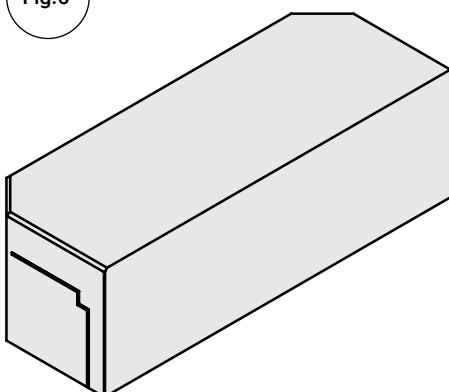


PF Series Carvable Jaws  
Part Number: PF420-2C

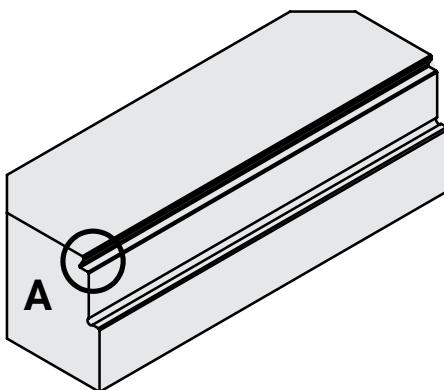


PF Series Dovetail Jaws  
Part Number: PF420-2D

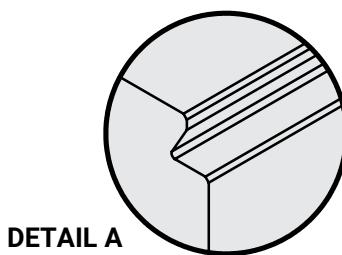

DETAIL A

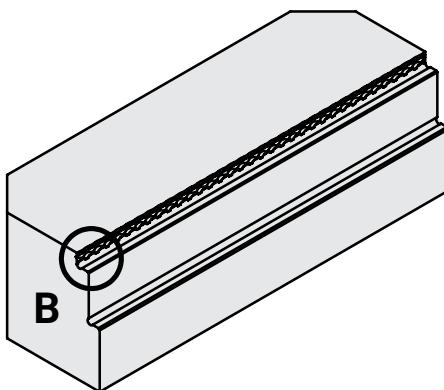

PF Series Serrated Jaws  
Part Number: PF420-2S

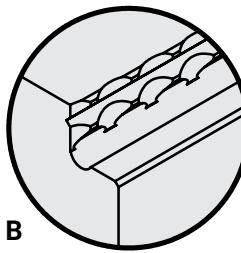

DETAIL B

# CENTERLINE ADJUSTMENT

The PFW Series of vises are designed for quick and easy adjustment of the vise centerline.


1. Loosen the four centerline adjustment bolts using a 9/64 hex wrench
2. Adjust the centerline by sliding the nut and screw assembly within the body of the vise. A mallet may be required to gently tap the ends of the screw in the direction of the desired adjustment.
3. When the centerline is in the desired position, re-tighten the four centerline adjustment bolts.

# LASH REMOVAL

Along with an easily adjustable centerline, the PFW vises also have an extremely simple to use lash removal system.

1. Loosen the top lash release bolts (2X) on the top surface of the central holding block, using a 7/64 hex wrench.
2. Tap the top of the central holding block with your finger.
3. Re-tighten the lash release bolts.

Fig.7

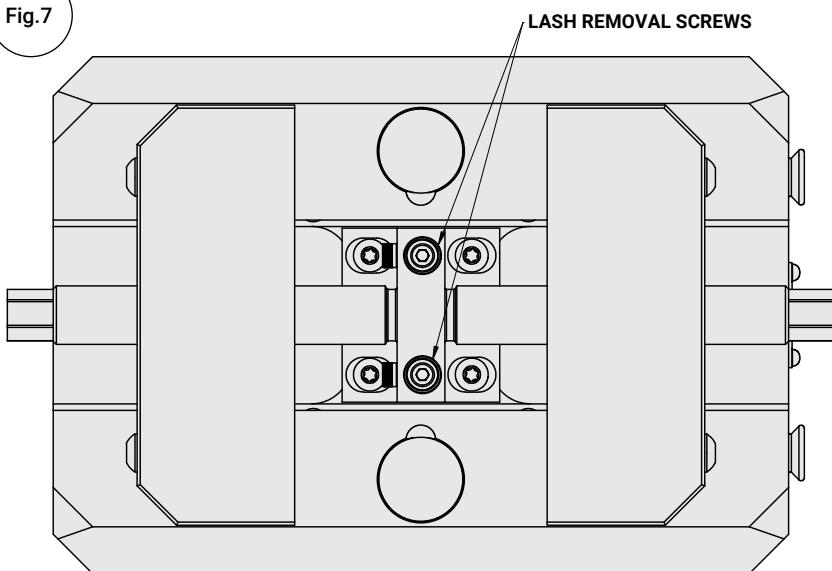


# MACHINING THE CARVABLE JAWS

For the best results when machining the carvable jaws for the PFW Series of vises, follow the procedure below.

1. Use parallels, vise hard jaws, or other precision cut blocks that are set just below the cut surface as shown in the diagram below.
2. Clamp your precision blocks in the vise. For the best accuracy, clamp the vise to the same amount of torque you will be using during production when cutting your jaws.
3. **DO NOT** cut inside the boundaries of the scribed lines on the jaw blanks. Cutting inside of these lines will damage the internal features of the jaw. Dimensions are shown below.

Fig.8

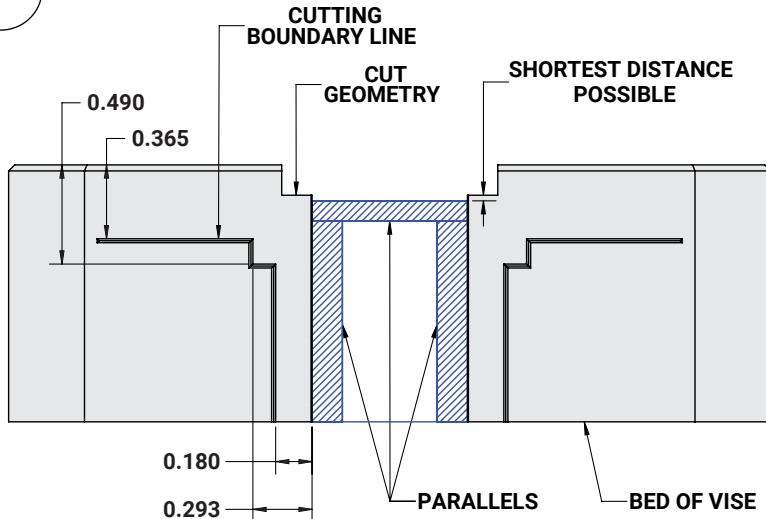

# MAINTENANCE SCHEDULE

It is very important to perform regular maintenance on your Kurt vise to assure proper operation. Improper maintenance will result in poor vise performance and may void your warranty.

## Daily/Weekly

1. Remove chips from surface of vise.
2. Visually inspect for chips, seals for damage and cleanliness.
3. Visually inspect for chip entrapments and remove when necessary.
4. Air-dry and apply rust inhibiting oil to the machined surface of the vise.

## Monthly

1. Open the vise to the maximum opening.
2. Remove the movable jaws using the procedure on page 10.
3. Turn the movable jaw over and clean the inside cavity.
4. Remove any chips, clean and apply a light coat of machine oil to the machined surface of the following item
  - a. Nut and Screw assembly (clean exposed threads on the screw)
  - b. Bed of vise (top of "rails")
  - c. Inside of the vise between the center ways.
5. Your vise is now ready for use. Open and close your vise to check for proper operation. Center the part to be clamped in the vise and close. Your parts should be centered from side to side to insure proper clamping.

## MAINTENANCE LOG/NOTES:

**A**ll Kurt Manufacturing Company industrial workholding products and parts with the exceptions noted below, are warranted against defects in material and workmanship for the life of the product or part. (The life of the product is defined as that point in time when such item no longer functions due to normal wear and tear.) Failure to properly maintain and/or properly operate the product or part that has been worn out, abused, heated, ground or otherwise altered, used for a purpose other than that for which it was intended, or used in a manner inconsistent with any instructions regarding its use. The sole obligation of Kurt Manufacturing Company, Inc. (Kurt) and the purchaser's SOLE AND EXCLUSIVE REMEDY hereunder, shall be limited to the replacement or repair of any Kurt product or part (by an authorized Kurt technician) which are returned to Kurt Manufacturing Company's place of business or any authorized service center, transportation, shipping and postal charges prepaid, and there determined by Kurt Manufacturing Company to be covered by the warranty contained herein.



THE LIMITED WARRANTY DESCRIBED HEREIN IS MADE EXPRESSLY IN LIEU OF ANY OTHER EXPRESSED OR IMPLIED WARRANTIES, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. KURT MANUFACTURING COMPANY IS NOT RESPONSIBLE FOR THE IMPROPER USE OF ITS PRODUCTS. KURT SHALL NOT BE LIABLE FOR ANY DIRECT, INDIRECT, INCIDENTAL SPECIAL OR CONSEQUENTIAL DAMAGES, INCLUDING BUT NOT LIMITED TO, LOSS OF USE, REVENUE OR PROFIT.

KURT ASSUMES NO LIABILITY FOR, AND MAKES NO WARRANTY REGARDING ANY PURCHASE ITEMS WHERE THE MANUFACTURER OF SUCH ITEM EXTENDS A SEPARATE WARRANTY.



Thank you for your  
purchase! If you have any  
feedback or questions  
please contact us:

**Kurt Industrial Products // A Division Of Kurt Manufacturing**

9445 East River Road NW | Mpls, MN 55433  
Phone 763-574-8309 | Toll Free 877-226-7823  
Fax 763-574-8318 | Toll Free Fax 877-226-7823  
[kurtworkholding.com](http://kurtworkholding.com) | [workholding@kurt.com](mailto:workholding@kurt.com)

Manual Revision:  
2026-02-06